 
 


AF80.20-P-6002A	Central locking occasionally does not open with infrared remote control	22.4.96
-----------------	---	---------

MODEL 129 as of 1.12.94
with DAS 2

	Cause	Remedy	
	Irregularities in PSE input circuit  During the unlocking operation with the infrared remote control the CL is sometimes not unlocked even though the green signal lamp on the interior rearview mirror comes on.	1 Install new PSE pump  The PSE pump is marked with a white dot and can be ordered from ZVL Gernersheim.	

Parts ordering note

Part no.	Designation	Quantity
129 800 08 48	PSE pump	1