
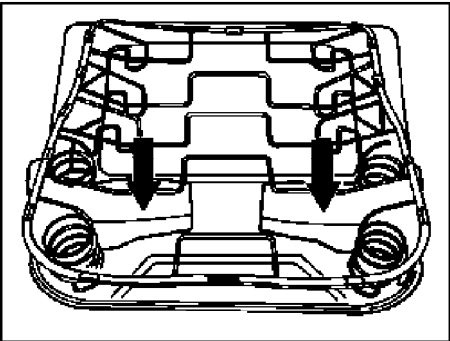


AF91.10-U-2101A	Front seat cushion has insufficient side support when driving through turns, front seat cushion cover damaged in the area of the seat cushion adjustment knob	29.4.97
-----------------	---	---------

MODEL 124

Damage Code	Cause	Remedy	
No Code	<ul style="list-style-type: none"> <li>Insufficient side support of seat cushion frame.</li> <li>With extreme weight on the front seat, the seat cushion cover can be pinched at the front seat tilt adjustment mechanism.</li> </ul>	1    Install two foam block to the seat cushion padding on the left and right side between the two front springs. Part No: 124 910 16 75   <b>Production Phase-In:</b> As of 4/89 production.	



P91.10-0544-01

Teile-Bestell-Hinweise

Teil-Nr.	Designation	Anzahl
124 910 16 75	Foam block	