

SUBJECT: DEALER TECHNICAL BULLETIN 22/99

22/99 - 1 RECALLS AND SERVICE CAMPAIGNS: WHEN REPAIRING ANY VEHICLE, ALWAYS CHECK THE VEHICLE MASTER INQUIRY FOR OPEN CAMPAIGNS

22/99 - 2 GROUP 07 - MODEL YEAR 1999, MODEL C230 (202.024) AND SLK230 (170.447):
If you receive complaints of hesitation after cold start and rough shift 1-2 and 2-3 during warm up, they may be caused by the engine control module (ME-SFI) being very lean after cold start causing rough engine idle and consequently sending an incorrect load signal (load signal too high) to the transmission. To resolve, please install updated ME2.1 engine control module as follows:

	Old ECM	Modified ECM
SLK230 MY 1999	023 545 83 32	028 545 44 32
	024 545 57 32	028 545 44 32
C230K MY 1999	023 545 85 32	028 545 46 32 *
	026 545 14 32	028 545 46 32 *

* To become available at DCAG during week of May 10 - 14, 1999

Version codes have not changed, therefore, use the version code from the old ECM. Parts can be ordered from Retailer Parts Services. Please use Damage Code 54575 90.

H. Polz, Service Engineering

HPdg 5-11-99