


MODEL 129 as of 1.6.97
MODEL 140 as of 1.6.97
MODEL 170 as of 1.6.97
MODEL 170

with CODE (494) USA version
with CODE (498) Japanese version

- b Unlock button
- c Lock button

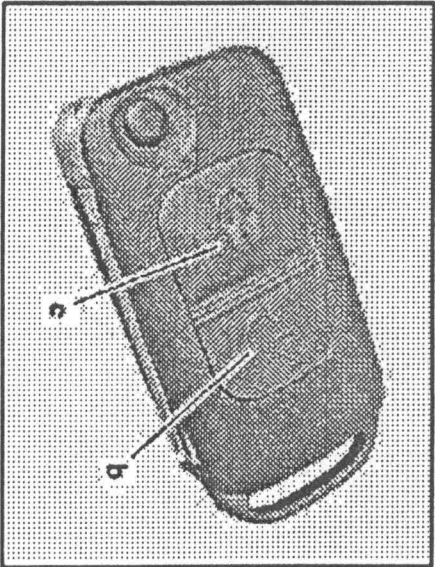

P80.35-0213-01

i	If the vehicle cannot be locked or unlocked it may be necessary to synchronize the lock system		
1	Press unlock button (b) or lock button (c) momentarily twice		
2	Turn key in steering lock to position "2" within the next 30 seconds		