


Uresei engine, as well as with engine 1U4, mark front and rear propeller shaft with vibration eliminator in relation to each other (refer to arrows). Remove front propeller shaft in forward direction and rear propeller shaft in rearward direction.

For lack of space, removal of complete propeller shaft toward the rear is not possible on vehicles with vibration eliminator.


11 On all vehicles starting August 1982 the front and rear propeller shafts are pertinently identified.

The front shaft is provided with a hump and the yoke of the rear shaft with two-arrow-like humps (arrows). The hump of the front shaft should be located between the two arrows on yoke (arrows).

Note: Identification has already been available on propeller shafts prior to August 1982, but not been taken into consideration during assembly. For this reason, propeller shafts on which the marks are not in agreement must be identified prior to removal and the two parts must be plugged together again in accordance with this identification.

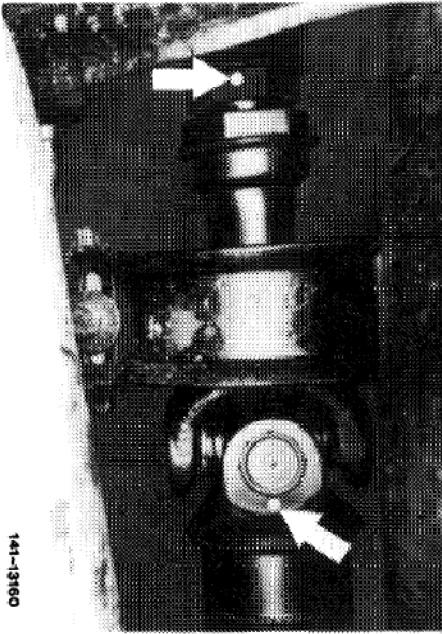

141-13160

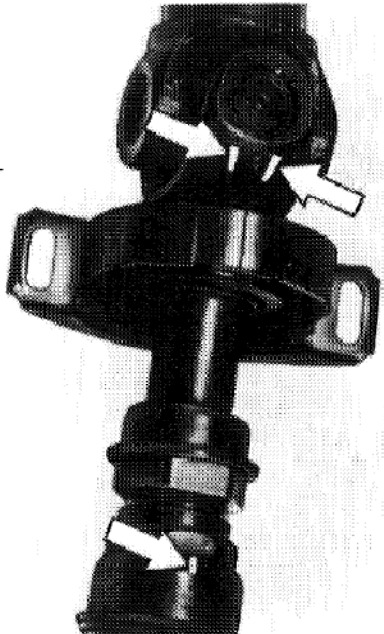

141-28660