


MODEL 163.154 #A as of 000001 up to 014254

i Vehicles within the Effective Serial Number Range, must have the following work performed during next scheduled maintenance or service. Install pinch nut to ensure proper tightening torque of rear stabilizer bar mounting.

i Damage code for warranty/goodwill claim: 32 920 07

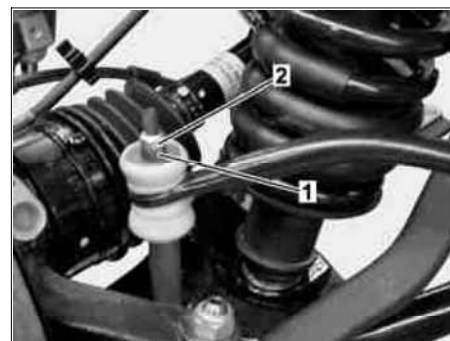

P32.35-2001-01

	Installation		
1	Retorque nut (1) on rear stabilizer bar connecting rod bolt	Nm	*BA32.20-P-1001-04F
2	Install pinch nut (2) on top of previously torqued connecting rod bolt nut		
3	Counterhold connecting rod bolt nut (1) while torquing pinch nut (2)	Nm	*BA32.20-P-1003-04F
4	Repeat for opposite side		

 Rear axle torsion bar

Number	Designation		Model 163
BA32.20-P-1001-04F	Nut, connecting rod to torsion bar	Nm	28
BA32.20-P-1003-04F	Pinch nut, connecting rod to torsion bar	Nm	28

Parts ordering notes

Part no.	Designation	Quantity
N910123 008001	Pinch Nut	1 per side