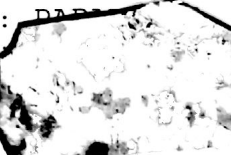


AUTOHAUS IMPORT SERVICE
3450 NORTHEAST PARKWAY
SAN ANTONIO, TEXAS 78218
(210) 821-6167

REPAIR ORDER # 0031063- 1
 DATE : 06/23/2008
 PAGE 1 OF 1

CUSTOMER :  SUSAN
 ADDRESS :
 CITY : TX 78218
 PHONE 1 : EXT :
 PHONE 2 : EXT :

VEHICLE : 1988 MERZ 260 E
 LICENSE : DB9Y684 IN :
 : WDBEA26D5JA628624
 ENGINE : 2.6 TRANS : AUTO
 MILEAGE : 085917 OUT : 87966

PARTS

LABOR

QUAN	PART NUMBER	DESCRIPTION	PRICE	OP TECH	DESCRIPTION	PRICE
2.00	124 421 16 12	ROTOR (Disc), Front	110.00	PM 001 50	LOF - CHANGE OIL AND FILTER, TOP OFF	0.00
1.00	001 420 07 20	BRAKE PADS FT.	59.00		ALL FLUIDS, VISUAL SAFETY INSPECTION...	
2.00	201 540 03 17	BRAKE SENSOR/LATE	9.40		FOUND LARGE HOLE IN CONNECTING PIPE FOR	
1.00	BG	ANTI-SQUEEL	9.85		REAR MUFFLER CUT SECTION OF LARGER DIA	
1.00	124 240 06 18	MOUNT,REAR	55.00		PIPE AND WELD AROUND HOLE INSTALL NEW	
1.00	102 184 01 01	FILTER/OIL	8.25		MUFFLER HANGERS	
1.00	OIL CHANGE SPECIAL	KIT.	24.95	BR 003 50	INSPECT BRAKES FRONT AND REAR,ADVISE	0.00
		FILTER DISPOSAL	1.50		REAR BRAKES OK FT. AT STOPS ,, INSTALL	
0.50	AV R-12	FREON	29.50		NEW FT. ROTORS AND PADS INSTALL NEW WEAR	
1.00	A/C	LEAK TEST DYE	8.75		SENSORS [2]	
2.00	124 492 00 44	MUFFLER HANGER	7.50	TR 019 50	REPLACE TRANSMISSION REAR MOUNT	0.00
1.00	201 492 01 16	SUPPORT	4.70	MS 001 50	TOTAL LABOR ON ABOVE REPAIRS/SERVICE	436.10
				AC 006 50	TOP OFF FREON ADD LEAK TRACE DYE SCAN	53.40
		SUBTOTAL	328.40		.5R LEAKS NEED TO RETURN CAR FOR RE-SCAN	
					AFTER SEVERAL WEEKS DRIVING W/ A/C ON	
					SUBTOTAL	489.50

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to the vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

LABOR : \$ 489.50
 PARTS : \$ 328.40
 SUBLET : \$ 0.00
 SUPPLIES : \$ 9.79
 SUBTOTAL : \$ 827.69
 TAX/FEES : \$ 27.48
 TOTAL : \$ 855.17
 MASTER CAR
 PAID : \$ 855.17
 DUE : \$ 0.00

X _____